

ROCA MERIDIAN IN TANK WALL HUNG PAN I SUPPORT (SOLID WALL)



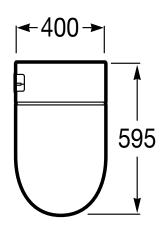

Dimensions are nominal measurements only

,		
SPECIFICATIONS		
Recommended Use	Domestic, Hotel and Commercial	
Material	Vitreous China	
Colour	White	
Weight	Pan: 45kg	
Water Inlet Position	Back Inlet	
Inlet Valve	Maximum working pressure 500kPa	
Seat	Matching top-fix, soft-close seat supplied with suite	
Rim Configuration	Box Rim	
Bowl Configuration	P Trap	
Set Out	P Trap: Refer to supplied template	
	60mm end of spigot to finished wall.	
Pan Fixing	Screwed to wall using fixings (supplied) and bedded with sealant	
Installation	As per AS/NZS 3500 and AS/NZS 3000	
Electrical	240VAC, 50Hz, 17W, IPX4	

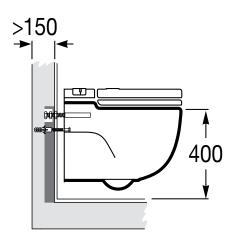

To see the complete ROCA range go to www.reece.com.au/bathrooms

CLEANING RECOMMENDATIONS

We recommend the use of soapy water or approved cleaners.


This product should not be cleaned with abrasive materials.

Damage caused by any improper treatment is not covered by the product warranty. Refer to Warranty Conditions.















MERIDIAN IN TANK WALL HUNG PAN I SUPPORT (SOLID WALL)

INSTALLATION INSTRUCTIONS


Note- This product will be required to be installed by a licenced plumber and electrician

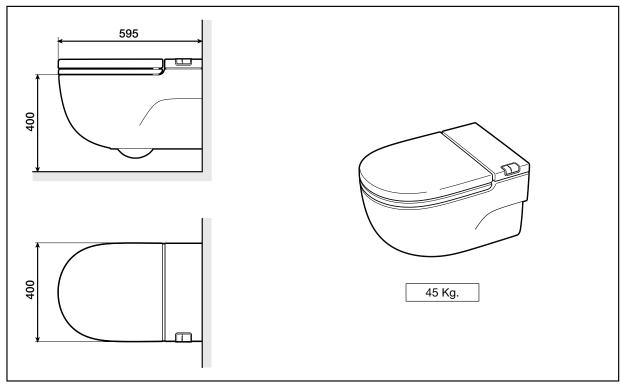

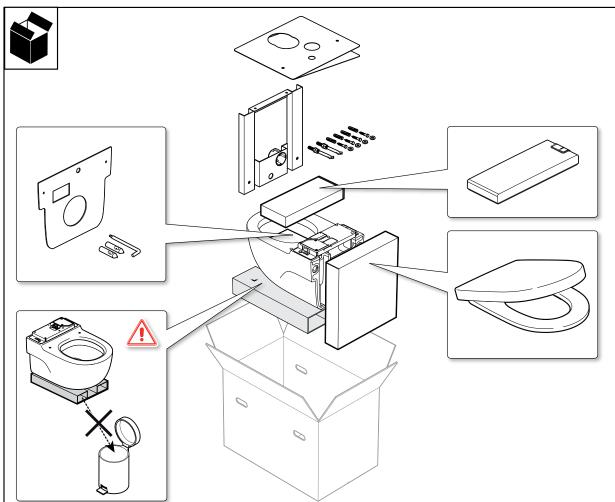






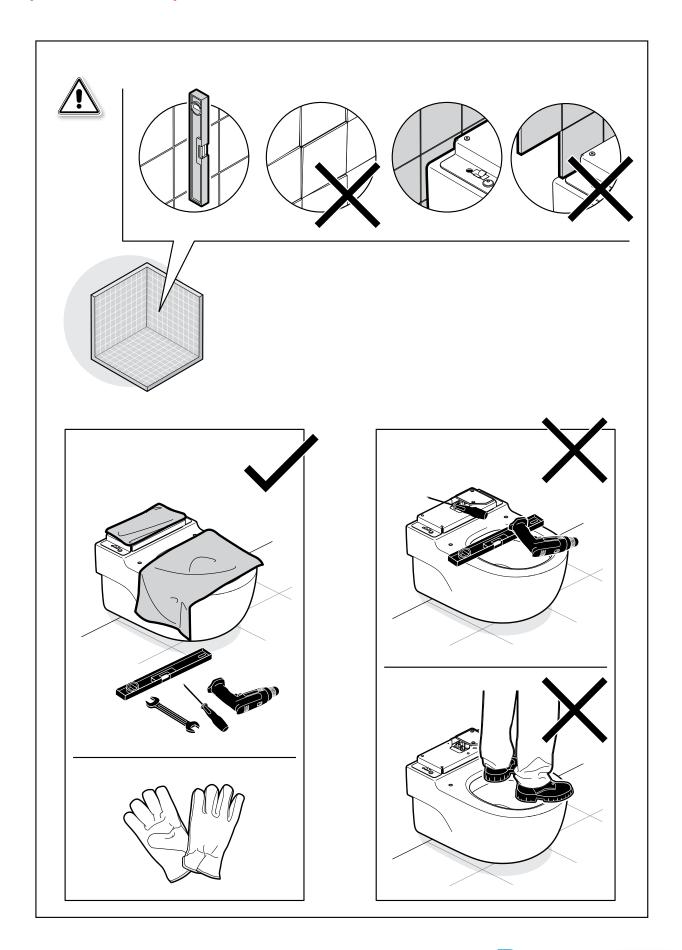




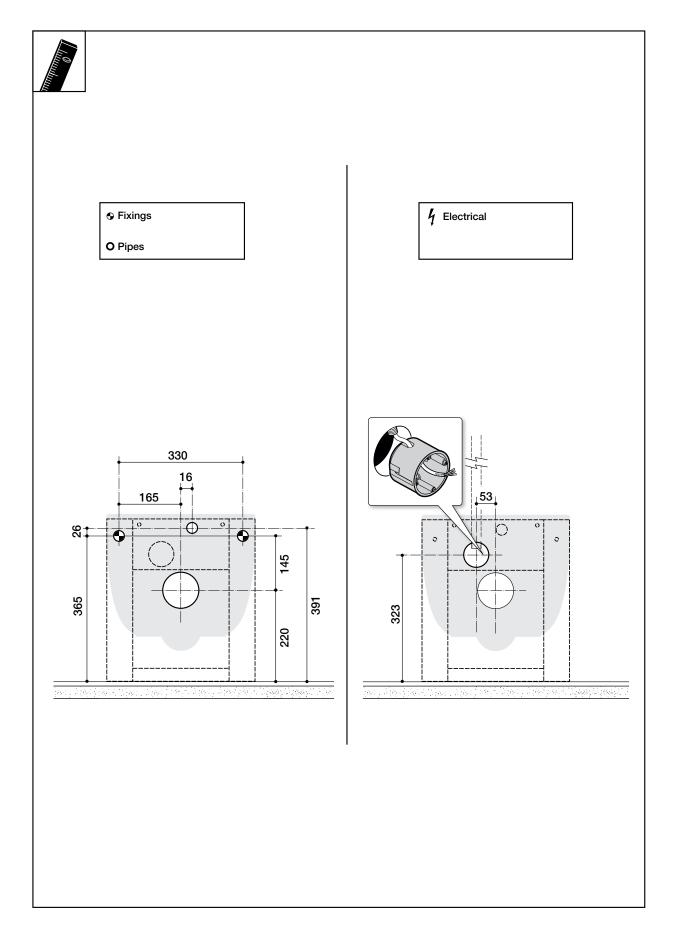






MERIDIAN IN TANK WALL HUNG PAN I SUPPORT (SOLID WALL)

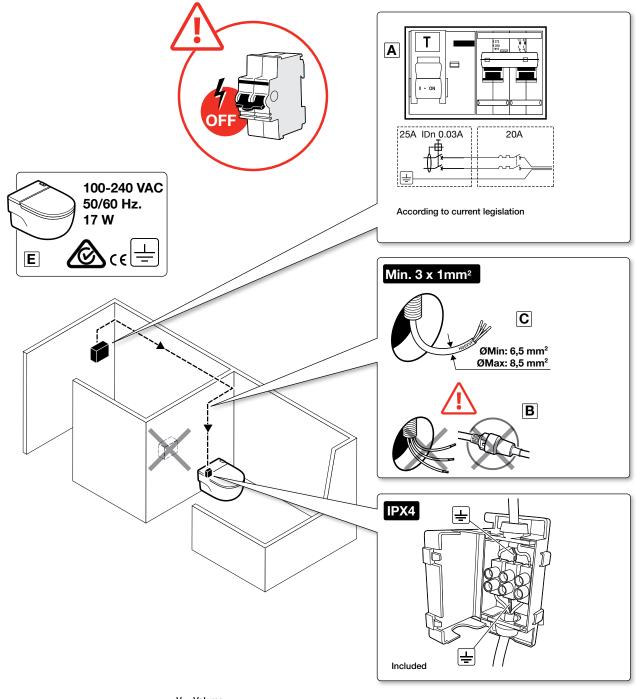

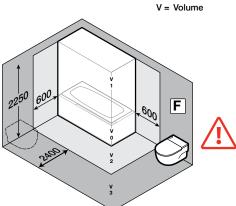


- A The electrical installation must be protected by means of a IDn 0,03A and 25A differential switch and a magnetothermal switch of 20A. Both switches must be placed outside the bathroom.
- [B] The power connection of this product must be permanently connected to a fixed electricity line. Placement of a plug is not acceptable.
- [C] The electrical line to be installed must be a flexible cable consisting of three wires (active, neutral, earth) of at least 1mm2 of section exclusively dedicated to the WC. In the event that, due to failure, it is necessary to handle or replace the power cable, this must only be done by Technical Service staff
- **D** The power connection must only be done inside the included IPX4 electrical box. In case of making a junction of the electrical line must be also used a box of this type.
- E The range of function of the WC is 240V, 50Hz.
- F The WC must be installed in the protection volume 3 of the bathroom. No electrical device must be introduced inside the WC.

NOTE: This product must be installed by qualified personnel, in according with the national current regulation.






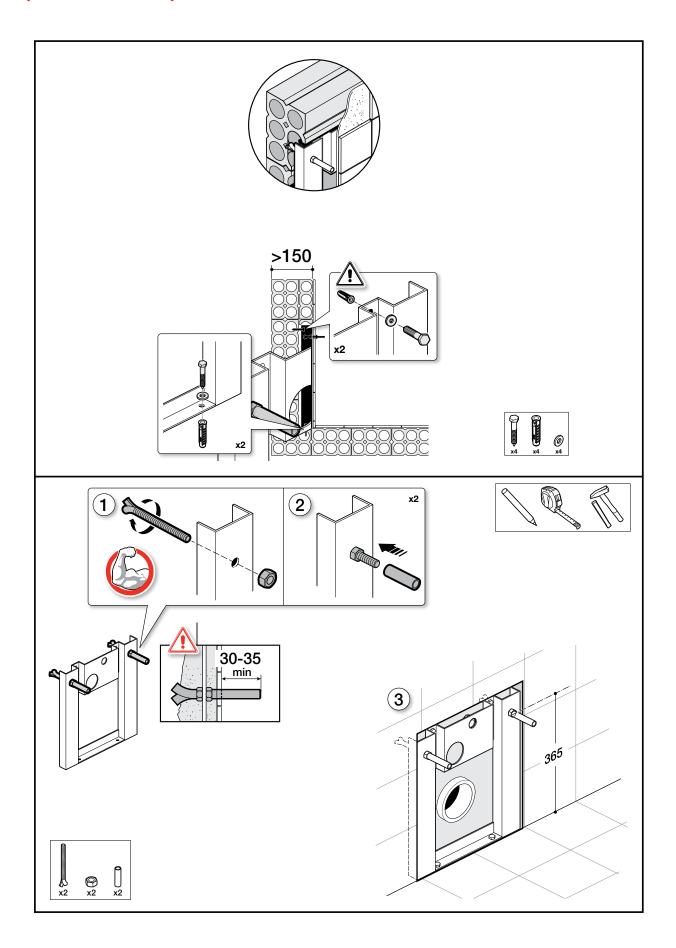






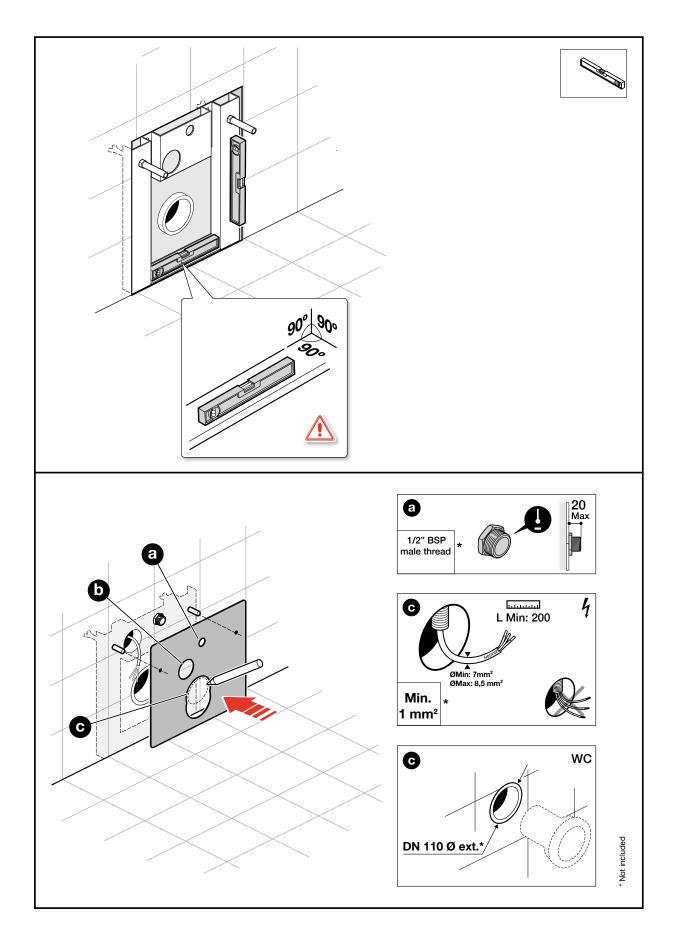




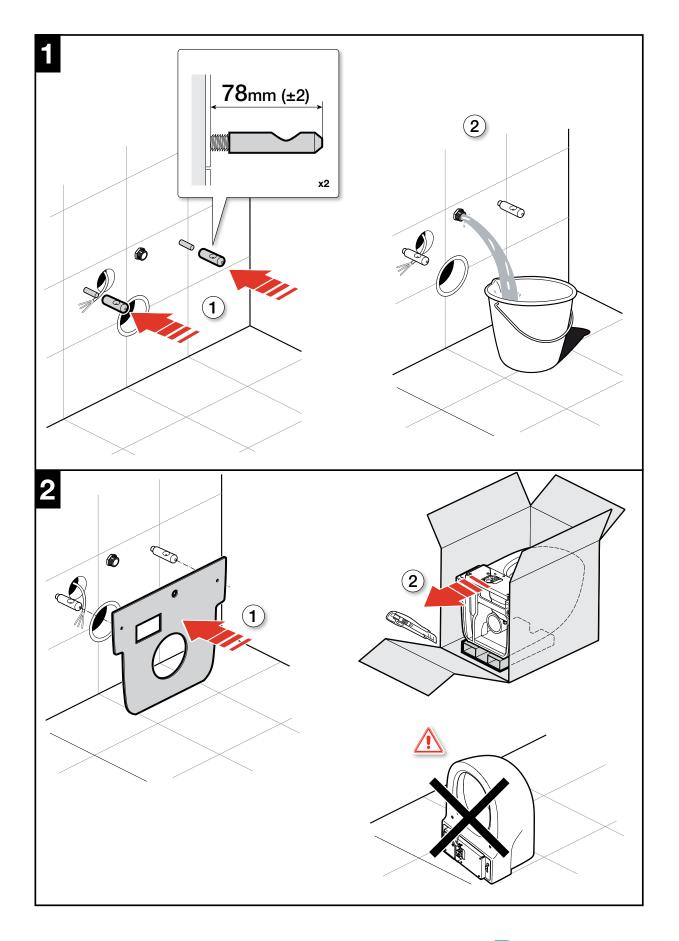






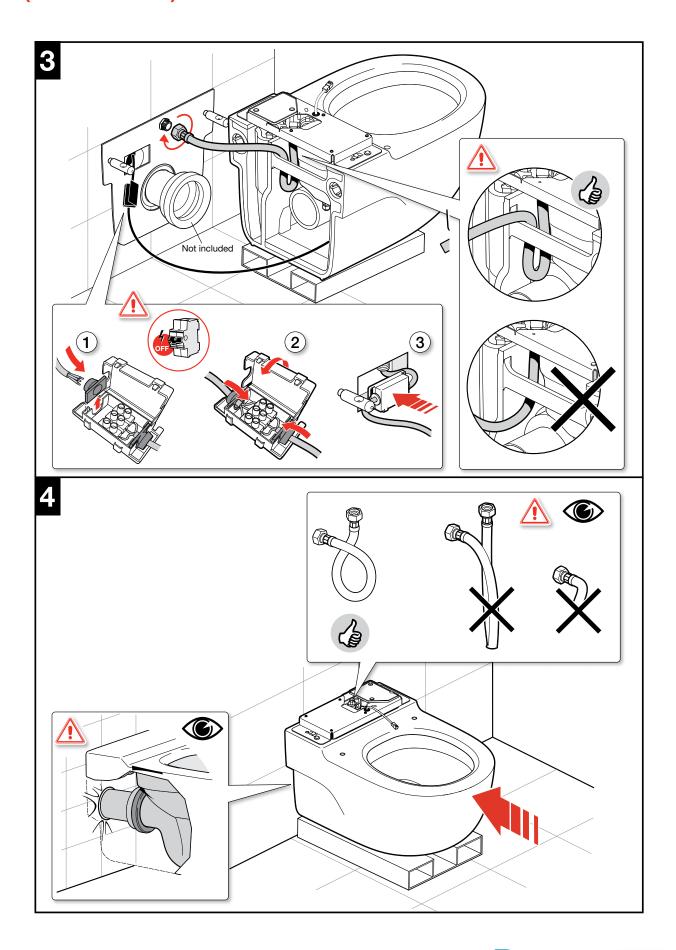





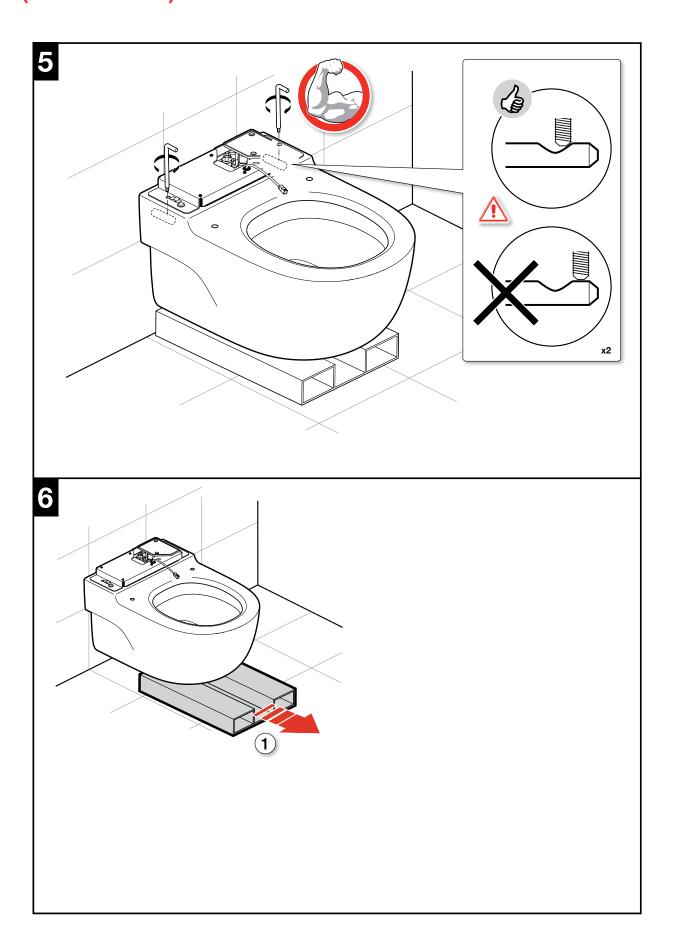





MERIDIAN IN TANK WALL HUNG PAN I SUPPORT (SOLID WALL)

SEAT INSTALLATION



- 1. Cover damper
- 2. Seat damper
- 3. Grub screw cover
- 4. Washer
- 5. Screws Fixings
- 6. Toggles
- 7. Spacer
- 8. Allen key (for Screw fixing)
- 9. Allen key (for Grub Screw)





MERIDIAN IN TANK WALL HUNG PAN I SUPPORT (SOLID WALL)

SEAT INSTALLATION





















MERIDIAN IN TANK WALL HUNG PAN I SUPPORT (SOLID WALL)

SEAT INSTALLATION




























MERIDIAN IN TANK WALL HUNG PAN I SUPPORT (SOLID WALL)

BACK COVER INSTALLATION

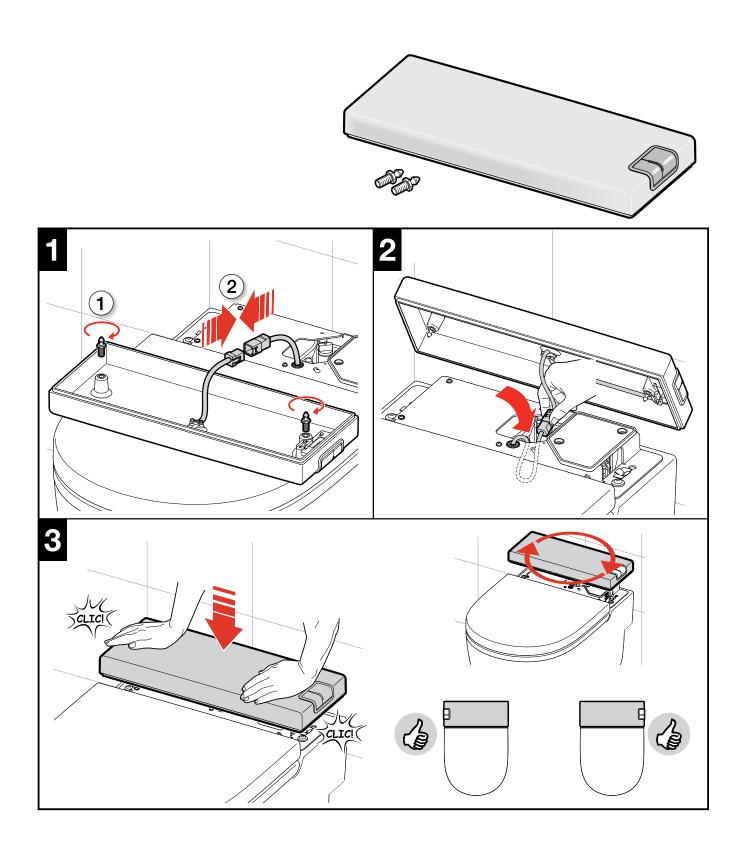







ROCA MERIDIAN IN TANK WALL HUNG PAN I SUPPORT (SOLID WALL)

BACK COVER INSTALLATION

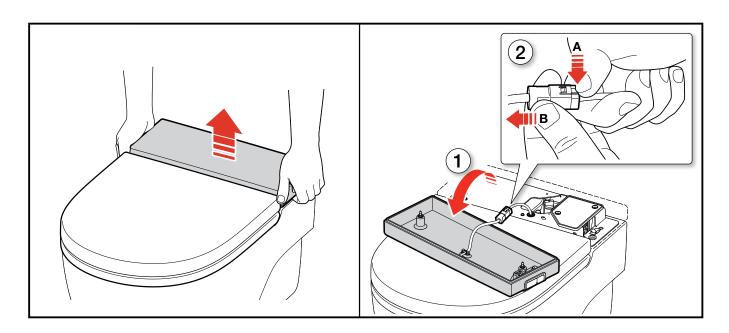

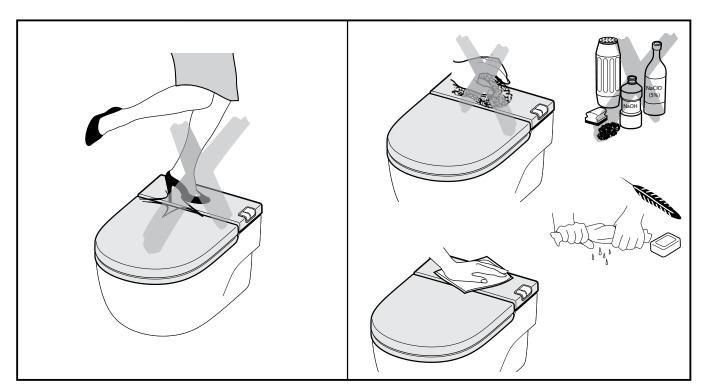






MERIDIAN IN TANK WALL HUNG PAN I SUPPORT (SOLID WALL)

MAINTENANCE

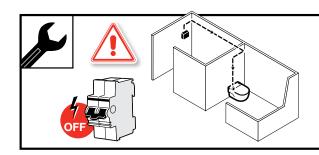

Before any maintenance operation, shut off the toilet power supply line.
















When WC has been unplugged for a long time or for the first use allow 5 minutes before operation.

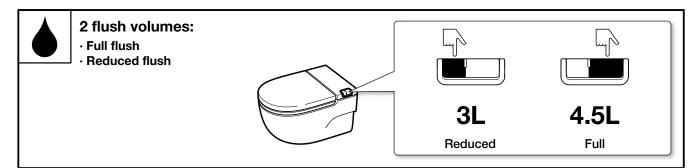


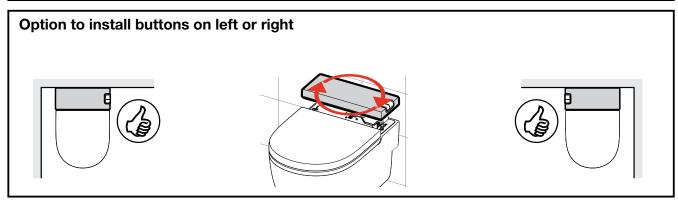







MERIDIAN IN TANK WALL HUNG PAN I SUPPORT (SOLID WALL)

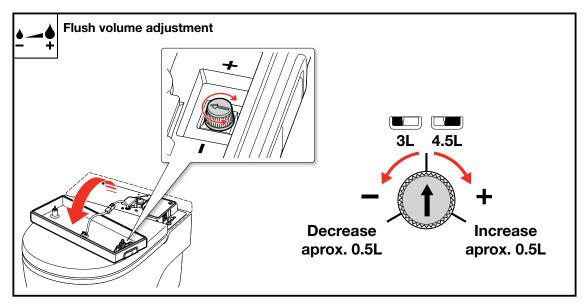

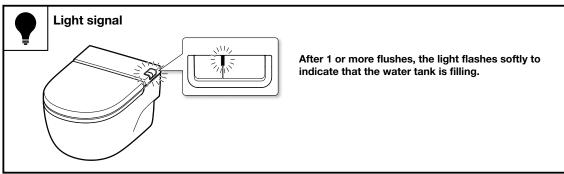


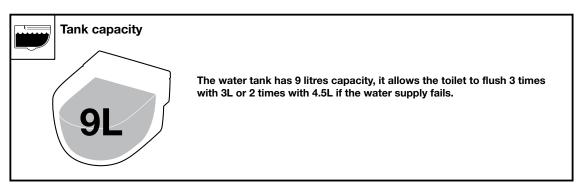



Power supply failure

- In case of power supply failure, the toilet remains operative for a number of flushes (see table).
- When there is not enough power in the toilet, the light flashes at a high frequency.








MERIDIAN IN TANK WALL HUNG PAN I SUPPORT (SOLID WALL)



In case of long periods without use



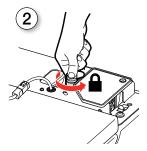





When not using for a long period (especially in cold places to avoid the risk of freezing of the water in the tank, which could damage the toilet):

- 1) Remove rear cover
- 2 Close the stop valve
- (3) Flush until no water flushes
- (4) Shut off power supply line



Temperature usage range







It is not recommended to install in places out of this range




Range of inlet pressure

50 kPa ~ 500 kPa

It is not recommended to install in places out of this range





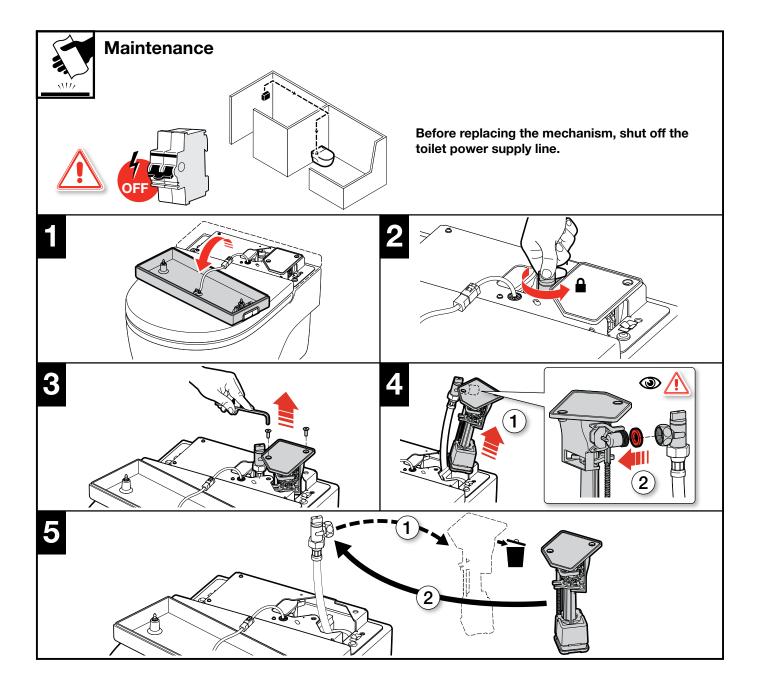






MERIDIAN IN TANK WALL HUNG PAN I SUPPORT (SOLID WALL)

SPARE PARTS

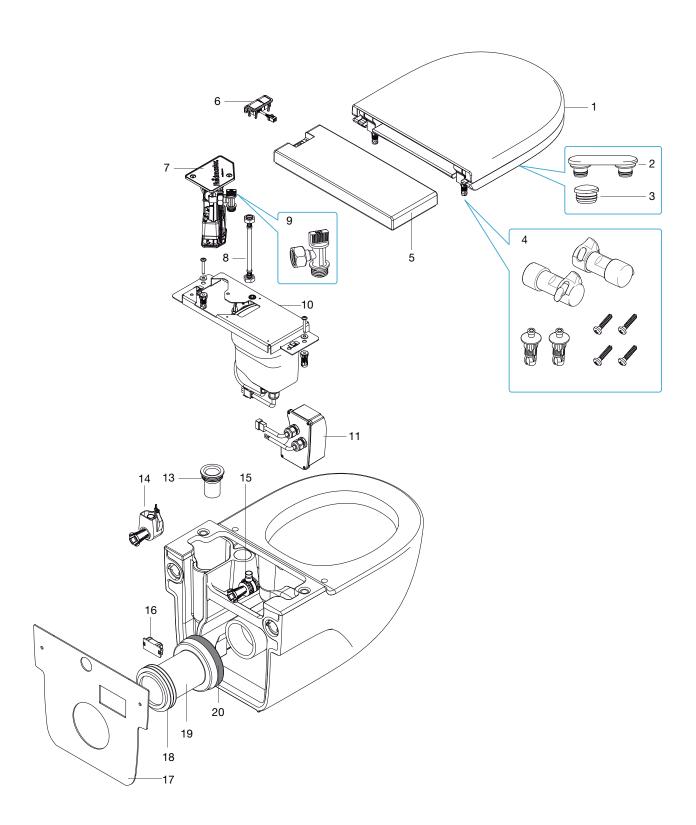





ROCA MERIDIAN IN TANK WALL HUNG PAN I SUPPORT (SOLID WALL)

SPARE PARTS

Picture	Reece Code	Product Description
200° 111	9506158	MERIDIAN IN TANK TOILET SEAT (PART 1, 2, 3 AND 4)
Pack of 4	9506159	MERIDIAN IN TANK SEAT BUFFER - BOTTOM FLAP (PART 2)
Pack of 2	9506160	MERIDIAN IN TANK SEAT BUFFER - TOP FLAP (PART 3)
** 11	9506161	MERIDIAN IN TANK TOILET SEAT FIXING SET (PART 4)
	9506162	MERIDIAN IN TANK CISTERN LID INCLUDING PUSH BUTTON (PART 5 AND 6)
	9506163	MERIDIAN IN TANK INLET VALVE (PART 7)
	9506164	MERIDIAN IN TANK ASSEMBLY BLOWER (PART 10)
	9506165	MERIDIAN IN TANK CONTROL BOX (PART 11)
	9506166	MERIDIAN IN TANK FIXING FOR WALL HUNG PAN (PART: 14 &15)
	9506168	MERIDIAN IN TANK ELECTRICAL JUNCTION BOX (PART 16)
60	9506169	MERIDIAN IN TANK ADHESIVE FORM GASKET (PART 17)
100 mm	9506170	MERIDIAN IN TANK WALL FIXING BOLT SET
[3]	9506172	MERIDIAN IN TANK WALL HUNG PAN TEMPLATE



